

Project No: **BDHRN002**Job Card No **0078**

Notif.No.: 10049021

Activity: **1000**

Rev No: 20000622

Model.: F900EX

Sheet 1 of 1

A/C Regn: **D-AHRN**

Serial No.: 096

Type: F900EX

Starting Phase: Routine

Starting Work Centre: FALCON A/C TEAM

**Job Description: LUB H-stab Rear Hinge Pins**

ETOPS A/C: No

RVSM A/C: No

Warranty: -

ATA: 55

Check Type: 1A CHECK

Work Center	
FALCON A/C	

**Zone: 300**

## Corrective Action

0001	<b>Task carried out in accordance with the attached Customer Card that quotes the Operator code detailed below.</b>					  Order: 80069284 Operation: 0010 Phase: Routine - scheduling activity Work Center:FALCON A/C TEAM
	Accomplished		Inspected			
	Pers. No.	Date	Pers. No.	Date		
	Stamp		Stamp			

Completed & Confirmed on SAP IAW MOE 2.13.


**Defect Card Raised**

## Components Removed/Installed

	Part Number	Part Name	S/N	Location	Comm. Off/On
OFF					
ON					
OFF					
ON					
OFF					
ON					
OFF					
ON					

Occurance Report Raised? YES ☐

Operations Above &amp; Notifications Completed IAW MOE 2.13.

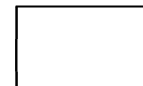

OEM Code: 55-10-33-640-801

Operator Code: 55-10-33-640-801-01

Form No: JA-SAP-MTX-002

Printed by: ADAMOVIC G



Printed: 03.09.2012

13:34:17

Print No: 1

Operator: **HERON AVIATION**

Work Card No.: **27.255**

Serial No.: **096**

Model: **FALCON 900EX**

**PKG # 2 2A INSPECTION**

Reg No.: **D-AHRN**

Workorder No.: \_\_\_\_\_

	Date	A/C HRS	AFL	APH			
Due At	<b>25-NOV-2012</b>	<b>4410:47</b>					
Accomplished							

TECHNICIAN SIGNATURE: \_\_\_\_\_ KIND OF CERTIFICATE & NO.: \_\_\_\_\_

INSPECTED BY: \_\_\_\_\_ KIND OF CERTIFICATE & NO.: \_\_\_\_\_

TECH	INSP	LABOR-HRS HRS.MINS
------	------	-----------------------

**>55-10-33-640-801- LUBRICATION OF THE HORIZONTAL STABILIZER REAR  
01 HINGE PINS**

\_\_\_\_\_

REMARKS : \_\_\_\_\_

AMM 55-10-33-640-801

## FALCON 900EX AIRCRAFT MAINTENANCE MANUAL

TASK 55-10-33-640-801

### LUBRICATION OF THE HORIZONTAL STABILIZER REAR HINGE PINS

**WARNING: SERIOUS PERSONNEL INJURIES CAN RESULT FROM OPERATIONS ON ACTIVE FLIGHT CONTROLS IF THE FOLLOWING INSTRUCTIONS ARE NOT OBSERVED:**

- THE FLIGHT CONTROLS MANEUVERING SPACES MUST BE UNOBSTRUCTED,
- APPROPRIATE SAFETY FENCES AND WARNING LIGHTS MUST BE INSTALLED AROUND THE AIRCRAFT,
- THE PERSONNEL INSIDE THE FENCED AREA MUST BE AWARE OF THE ONGOING OPERATIONS AND OF THE ASSOCIATED HAZARDS.

**WARNING: HYDRAULIC AND ELECTRICAL POWER SUPPLIES ARE PROHIBITED WHILE GREASING/ LUBRICATING HORIZONTAL STABILIZER REAR PINS.**

#### 1. OVERVIEW OF THE JOB

Operation code: 55-10-33-640-801-01

#### 2. LOGISTICS

##### A. Tools and Ground Support Equipment

Reference	Designation	Quantity
• <b><u>F7XC202000008</u></b>	TOOL BOX	
• <b><u>TO-20-947</u></b>	EMPENNAGE ACCESS PLATFORM	

##### B. Ingredients and Consumable Products

Designation	Additional designation
• <b><u>SYNTHETIC GREASE</u></b>	MIL-PRF-81322

#### 3. LUBRICATION OF HINGES


Refer to **fig. 1**

- A. Using a grease gun filled with **synthetic grease**, inject grease via grease nipples (1) and (2) of horizontal stabilizer rear hinge pins.

**NOTE:** Two openings in the skin panels provide for access to grease nipples 1 and 2.

## FALCON 900EX AIRCRAFT MAINTENANCE MANUAL

---

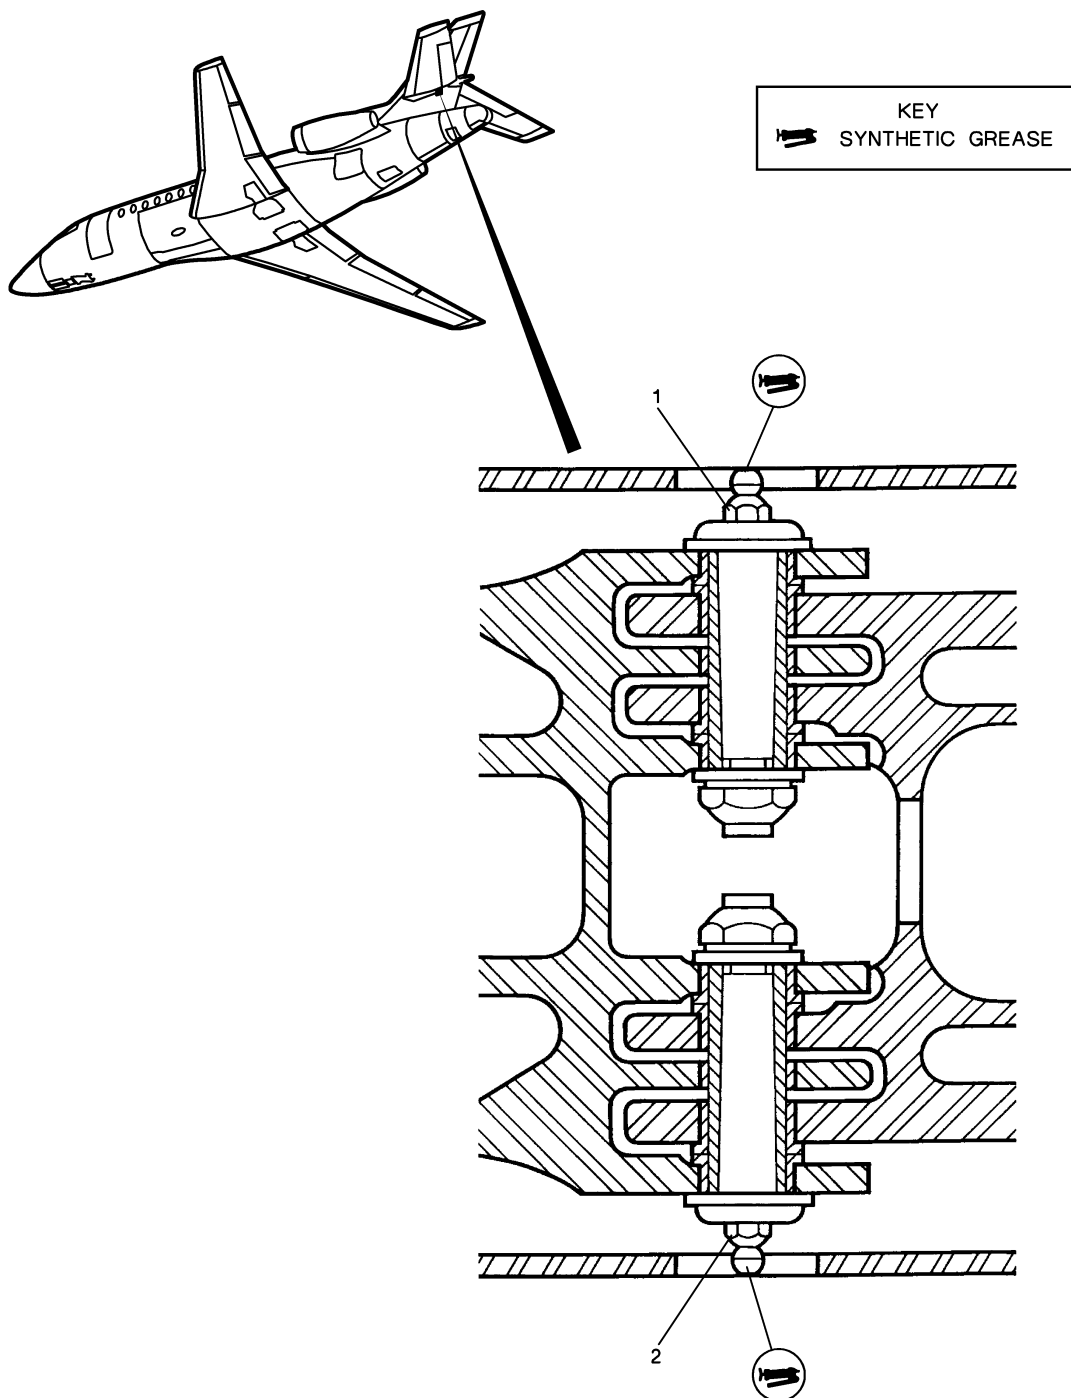

**Figure 1: Greasing of Horizontal Stabilizer Rear Hinge Pins**